

MODEL/YEAR MODÈLE / ANNÉE	DATE OF ISSUE DATE EN VIGUEUR	BULLETIN NUMBER NUMÉRO DU BULLETIN
2017 CIVIC SI	DEC. 21, 2017	B-1-17

NOISE FROM THE REAR SUSPENSION IN COLD TEMPERATURES


On some early production 2017 Civic Si models, there may be a noise from the rear suspension area when driving over bumps in temperatures below freezing (typically below -10°C). The most probable cause is insufficient noise isolation from the rear damper mounting base. To correct the problem, follow the repair procedure to install a new improved damper mounting base on both sides.

APPLIES TO:

2017 Civic Si	4-Door	2HGFC1E..HH200001 thru 2HGFC1E..HH200429
	2-Door	2HGFC3A..HH220001 thru 2HGFC3A..HH220311

REPAIR PROCEDURE:

1. Remove the rear dampers: [Rear damper removal](#).
2. Remove the damper mounting base by removing the damper cap and the self-locking nut.

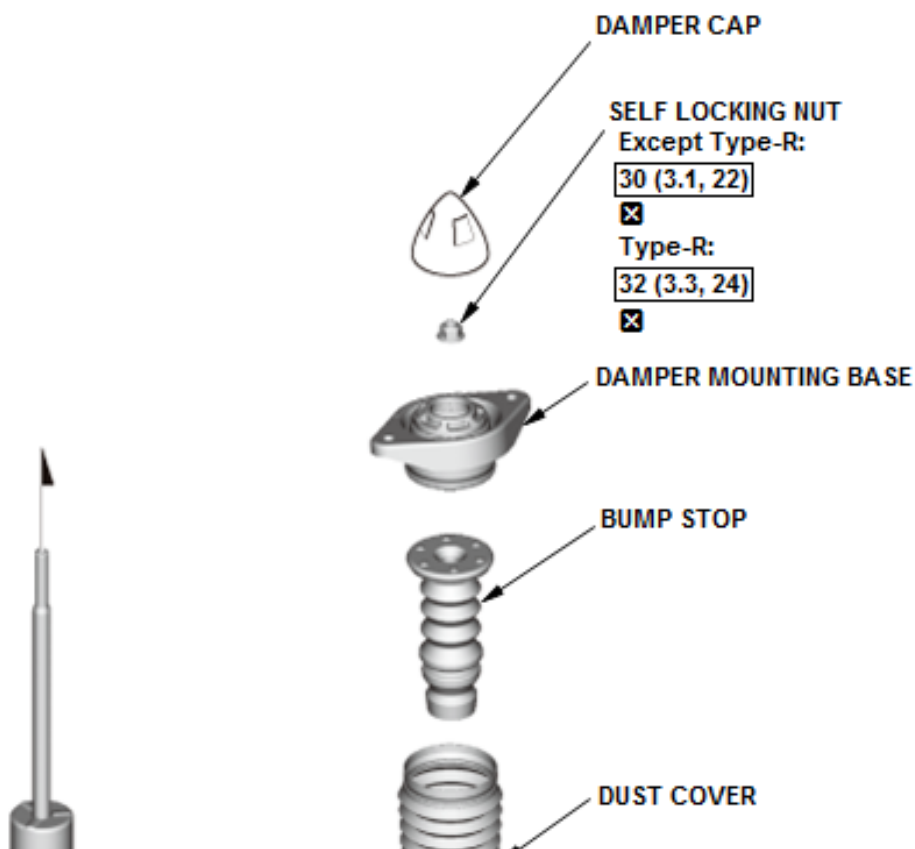

3. Install the new damper mounting base with a new self-locking nut and torque to 30 N·m (22 lbf·ft).
4. Reinstall the damper cap and reinstall the rear damper: [Rear damper installation](#).
5. Repeat steps 2 to 5 for the opposite side.

PARTS INFORMATION:

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>
52670-TBF-A02	Damper mounting base	2
90364-SG0-004	Lock nut (10mm)	2
90123-TBA-A00	Flange Bolt (8x32)	4
90177-TBA-A00	Flange Bolt (12x80)	2

WARRANTY INFORMATION:

Normal basic warranty policy (3 years / 60,000 km) applies. Use the following information to complete the warranty claim.

Defective Part Number: 52670-TBF-A01

<i>Labour Operation Number</i>	<i>Description</i>	<i>Flat Rate Time</i>
417101	Remove both rear dampers and replace mounting base	0.8 hr

Defect Code: 03214

Symptom Code: 04201

NOTE: Repairs may only be performed to resolve a customer complaint. Claims for preventative repairs will be denied.